




During the oil/UV injection the message "Oil Injection Error" appears

PROBLEM:

During the oil or UV additive injection phase, the Konfort VAS 581 003 displays the following message:

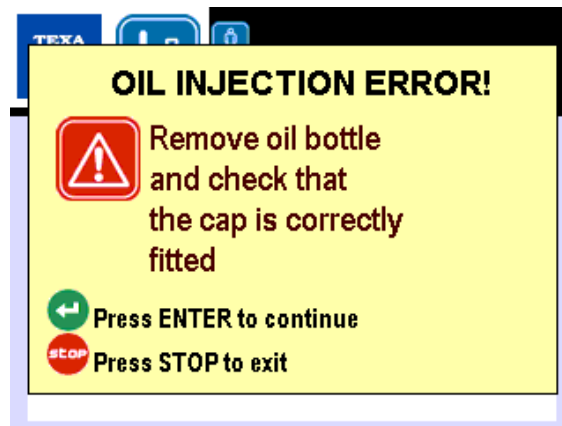

SOLUTION:

- Make sure that, from the **black upper cap** of the PAG/POE or UV bottle, a sufficient amount of oil and/or of UV additive has been poured:



- Make sure that the **black upper cap** of the PAG/POE or UV bottle has been hermetically closed:



- Check that the **deformable membrane** inside the PAG/POE or UV bottle will not be punctured or damaged:



In case the problem would persist, contact your **TEXA Service Provider**.